



# ETON America, LLC



## Service Bulletin

Bulletin No: 0055  
Date: 07/21/2008

### Beamer blowing fuses when using the turn signals

**PROBLEM:** All beamer and matrix 50 models in which the turn signals were moved above the handlebars will be affected. The Phillips head bolt that holds the turn signal to the top bracket is too long, and when tightened all the way down may touch the inside of the light bulb and cause a blown fuse when the turn signals are used.

**SOLUTION:** Order the new Part# 811203 quantity (2) and replace the LH and RH side to ensure proper operation. **If you have installed a windshield on your bike this bulletin will not apply. The turn signals will have to be moved below the handlebar assembly.**

