

WP-0016  
12/01/2004

# Viper ATV Power Loss

Viper models showing symptoms of power loss or bad throttle response maybe caused by clogged or dirty spark arrestor screen in the exhaust system.

## Symptoms of a dirty spark arrestor.

1. Loss of power or no power
2. Bad throttle response
3. No start situation

## Repair;

Remove the 4mm hex Spark Arrestor Screen retaining bolt from the muffler as shown in figure 2.

Remove the spark arrestor with a pair of needle nose pliers (figure 3).

Clean the screen using a commercial exhaust cleaner or replace the element part # 811008. (figure 4)

Reinstall the spark arrestor screen and replace the retaining bolt.

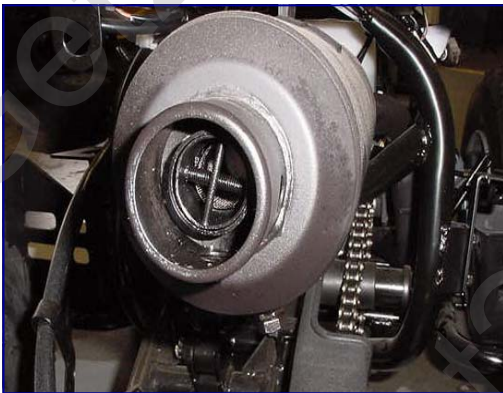


Figure 1



Figure 2



Figure 3



Figure 4

