

WP-0017
01/13/06

2006 Viper 4-strokes loss of power

Viper models showing symptoms of power loss or bad throttle response maybe caused by clogged or dirty spark arrestor screen in the exhaust system.

Symptoms of a dirty spark arrestor.

1. Loss of power or no power
2. Bad throttle response
3. No start situation

Repair;

Remove the 4mm hex Spark Arrestor Screen retaining bolt and nut from the muffler as shown in figure 2.

Remove the spark arrestor with a pair of needle nose pliers (figure 3).

Clean the screen using a commercial exhaust cleaner or replace the element part # 811462. (figure 4)

Reinstall the spark arrestor screen and replace the retaining bolt and nut



Figure 1



Figure 2



Figure 3



Figure 4

