



Service Bulletin

Bulletin No:
Date:

0019
08/15/03

Fuel Line Routing for Improve Flow

Affecting all Viper 50 & Viper 90 model years 2002-2004.

If your unit is showing any of the following symptoms this bulletin should correct the problem:

1. Being starved for fuel
2. You experience poor throttle response
3. You experience hesitation

Check your fuel line routing. If the fuel lines are routed as in fig #1 you may have a fuel flow restriction.

To improved fuel flow we suggest that you reroute the fuel line as shown in fig #2.



Fig #1

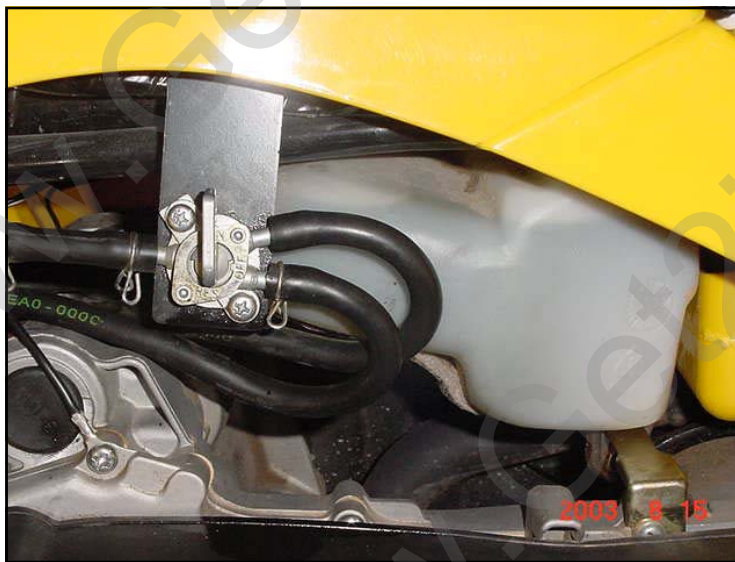


Fig #2

Reroute the fuel line from the bottom of the tank to petcock along side the tank instead of over the tank.